


PLAN

## NOTE:


Do not install the 5XA506 bars into the approach slab until all of the foundation fill is in place.

\* Use mechanical connectors for the couplers capable of developing 125% of the reinforcing steel specified yield strength. Provide epoxy coated couplers according to Section 836.02 A and repair any damaged epoxy coating according to Section 612.04 E.

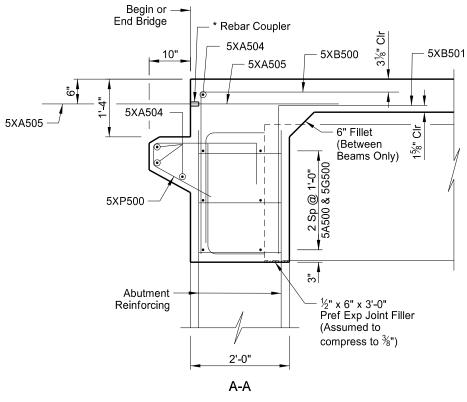

## 5XB500 5XP500 5XA505 (typ) (typ) (typ) 2-5A500 -- 5XB501 5G500 - 5N500 5N500 -(typ) (typ) 5XB500, 5XB501 & 5XP500 to Match Abutment Reinforcing 3½" 42 Sp @ 1'-0" ~ 5XA505

(APPROACH LIP NOT SHOWN)
ELEVATION

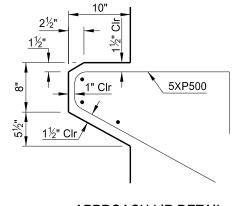

APPROACH LIP DETAIL

XXX

This drawing is preliminary and not for construction or implementation purposes.

QUANTITIES

SEE DWG 94-337.333R-15

MAPLE RIVER

ENDWALL DETAILS

3½"